



# **BRACKETT AERO FILTERS, INC.**



## **INSTRUCTIONS**

ASSEMBLY PART NO. BA-162

AIRCRAFT MODELS: Partenavia P68, P68B, P68C, P68 "Observer"

Packing List: Assembly No. BA-162

- 1 Each - Foam Element PN BA-162E
- 1 Each - Decal PN BA-162-01
- 2 Sheets - Installation Instructions BA-162-02
- 1 Sheet - STC with Approved Model List SA-71GL


## **INSTALLATION INSTRUCTIONS**

- STEP 1. Remove grill PN 68-7.5057C-1.
- STEP 2. Remove and discard both the screen PN 68-7.5057C-7 and element PN 68-7.5057C-13. (See Page 2)
- STEP 3. Clean grill and air box as required.
- STEP 4. Install filter element PN BA-162E into air box PN 68-7.5053C-1. NOTE: Be sure the element fits against all the sides to insure a good seal. (See Page 2)
- STEP 5. Reinstall grill PN 68-7.5057C-1.
- STEP 6. Install decal PN BA-162-01 on air box, top center.
- STEP 7. Complete required paper work, FAA Form 337 and log book entry.

SERVICING: Under normal conditions, replace filter element, PN BA-162E, after 100 hours use or after 12 calendar months, whichever comes first. Under severely dusty conditions, check daily and replace when element is 50% covered with foreign material. Visually inspect backing screen and all attaching parts for cracking or damage, replace as required. For Continued Airworthiness Instructions, see Form I-194.



# BRACKETT AERO FILTERS, INC.

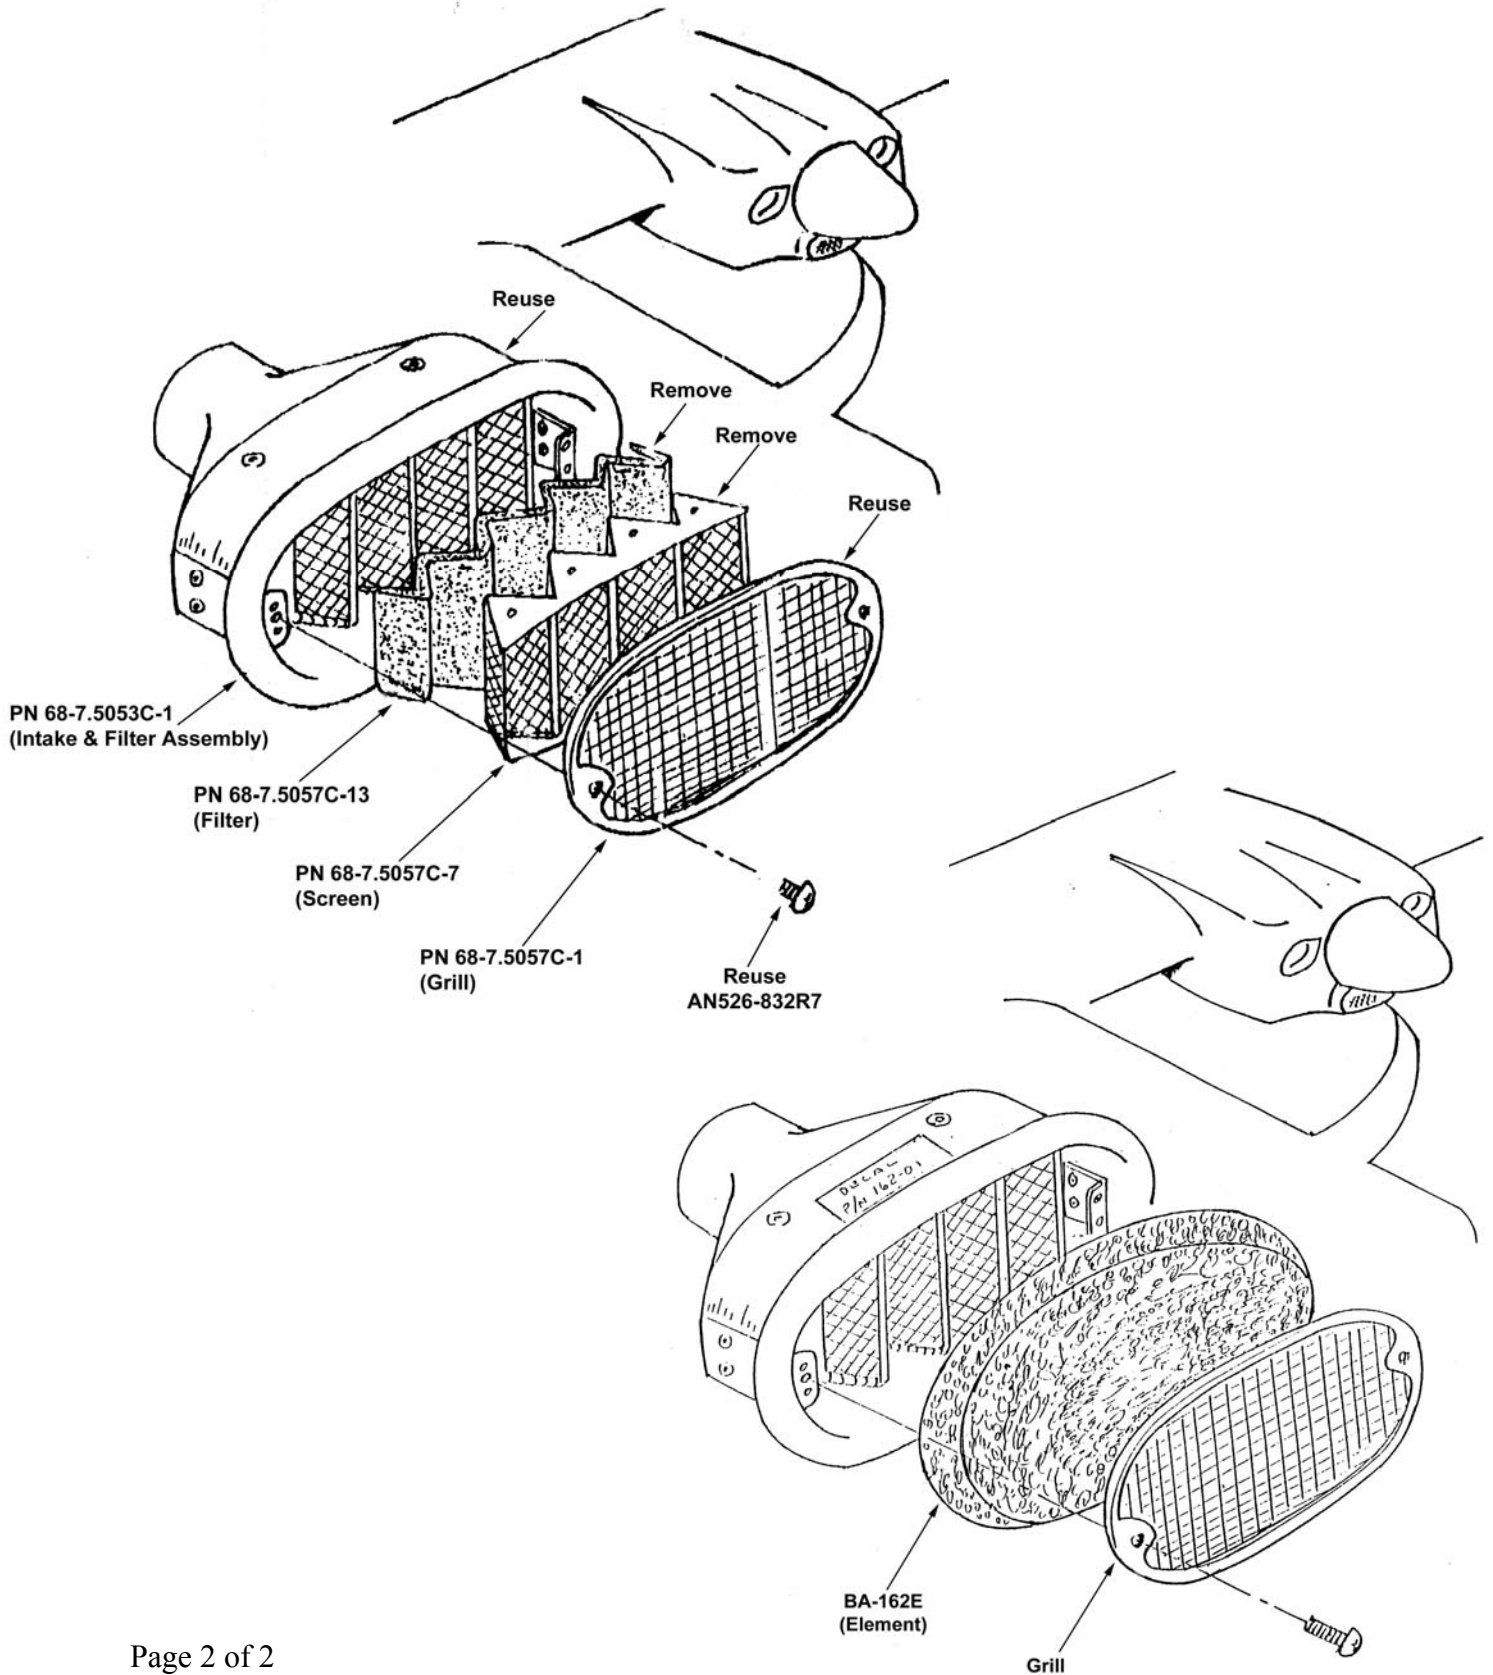

United States Of America  
Department of Transportation - Federal Aviation Administration  
**Supplemental Type Certificate**

*Number* SA71GL

*This Certificate issued to* BRACKETT AERO FILTERS, INC.  
7052 Government Way  
Kingman, Arizona 86401

*certifies that the change in the type design for the following product with the limitations and conditions therefor as specified hereon meets the airworthiness requirements of Part \* of the \* Regulations.*

*Original Product Type Certificate Number:* \* \*See attached Approved Model List (AML)

*Make:* \*(AML) No. SA71GL for list of approved aircraft

*Model:* \*models and applicable airworthiness regulations.

*Description of Type Design Change:* Installation of air filters in accordance with AML No. SA71GL dated April 17, 1995, or later FAA approved revision.

*Limitations and Conditions:* Approval of this change in type design applies to the above aircraft model(s) only. This approval should not be extended to aircraft of this model on which other previously approved modifications are incorporated unless it is determined that the interrelationship between this change and any of those other previously approved modifications will introduce no adverse effect upon the airworthiness of that aircraft. A copy of this Certificate and FAA Approved Model List (AML) No. SA71GL dated April 17, 1995, or later FAA approved revision must be maintained as part of the permanent records for the modified aircraft.

*This certificate and the supporting data which is the basis for approval shall remain in effect until surrendered, suspended, revoked or a termination date is otherwise established by the Administrator of the Federal Aviation Administration.*

*Date of application:* January 9, 1975

*Date reissued:* March 3, 1983, June 20, 2000

*Date of issuance:* February 21, 1975

*Date amended:* April 17, 1995



*By direction of the Administrator*

for Jim Liza Phalabanan  
(Signature)

Manager, Tech. and Admin. Support Staff  
Los Angeles Aircraft Certification Office  
(Title)


Any alteration of this certificate is punishable by a fine of not exceeding \$1,000, or imprisonment not exceeding 3 years, or both.

FAA APPROVED MODEL LIST (AML) NO. SA71GL  
BRACKETT AERO FILTERS, INC.

FOR  
INSTALLING AIR FILTERS

Issue Date: April 17, 1995

ITEM	AIR FILTER MODEL NUMBER	TOP DRAWING		AIRCRAFT MAKE	AIRCRAFT MODEL	ORIGINAL TYPE CERTIFICATE NUMBER	CERT. BASIS	AML AMENDMENT DATE
		NUMBER	REVISION & DATE					
63	BA-152	BA-152	N/C 7/14/92	Twin Commander	500	6A1	CAR 3	-----
64	BA-121	BA-121	B 12/5/94	Piper	PA-30, PA-39 (with STC SA787WE)	A1EA	CAR 3	-----
65	BA-162	BA-162	A 12/5/94	Partenavia Costruzioni Aeronautiche	P68, P68B, P68C, P68 "Observer"	A31EU	FAR 23	-----
66	BA-8610	BA-8610	A 11/22/94	Piper	PA-23-250, PA-E23-250 (with STC SA909WE)	1A1D	CAR 3	-----
67	BA-153	BA-153	C 4/08/01	Twin Commander	500-A, 500-B, 500-U, 500-S 560-F, 680F, 680FL, 680FL(P)	6A1 2A4	CAR 3 CAR 3	9/25/01

FAA Approved: 

Thomas A. Enyart  
Manager, Propulsion Branch

Date: 2/18/05

# BRACKETT AIR FILTER DOCUMENT I-194

PLACE IN AIRCRAFT RECORDS

CONTINUED AIRWORTHINESS INSPECTION  
 REQUIREMENTS AS PER FAR 23.1529  
 AND GENERAL PROCEDURES OF PART 43

INSPECTION INTERVALS: Pre-flight inspections, engine backfire inspection, 100 hour inspections, annual inspections, filter element replacements.

## INSPECTION PROCEDURES

- A. Pre-flight inspection: Per Pilots Operating Handbook, check filter assembly for security, damage or 50% contamination of element face. If found report to maintenance personnel prior to flight.
- B. Engine start-up backfire inspection: Prior to flight, check the entire intake system for security or damage. If a fire was present, the downstream face of the foam element will show erosion. If any irregularities are found see Chart I and also refer to the Aircraft Maintenance Manual for the intake system.
- C. At element replacement intervals: With the element removed, inspect the filter grill, filter frame, filter mountings and entire intake system for security, wear and any deformation. Note: On filter assemblies with gaskets, visually inspect inside and outside of frame for any signs of gasket looseness, movement or deterioration. If found refer to Chart I or the proper maintenance manual for your aircraft or component.

PART			INSTRUCTIONS
	REPLACE	REWORK	
FRAME	X		COMPLETE NEW ASSEMBLY
GASKET	X		ON FILTER FRAME, REMOVE OLD NEOPRENE GASKET AND ALL TRACES OF ADHESIVE DOWN TO A CLEAN ANODIZED FRAME SURFACE. USE ADHESIVE 3M#847 OR DOW CORNING RTV-732. COAT ENTIRE MATING SURFACE (GASKET TO FRAME). APPLY ADHESIVE FOLLOWING MANUFACTURER'S LABEL DIRECTIONS. WHEN FRAME AND GASKET ARE PLACED TOGETHER, CLAMP OR WEIGHT DOWN AT .75 LB./SQ. IN. OF CONTACT AREA. ALLOW TO CURE 24 HOURS PRIOR TO INSTALLATION. PRIOR TO REINSTALLATION OF FILTER, CHECK AIRBOX MATING SURFACE FOR IRREGULARITIES. IF FOUND, CORRECT PER MANUFACTURER'S REQUIREMENTS. UPON REINSTALLATION CHECK THAT THE GASKET MAKES 100% CONTACT. THE GASKET SHOULD BE COMPRESSED 50% FOR OPTIMUM SEAL.
GRILL	X		REPLACE WITH NEW GRILL
HARDWARE	X		REPLACE UNSERVICEABLE WITH NEW
SCREEN	X		COMPLETE NEW ASSEMBLY
SCREEN/GASKET	X		COMPLETE NEW ASSEMBLY ( ASSEMBLIES USING SCREEN GASKETS PRE 1981; BA-4106, BA-5110 AND BA-8110. )
ELEMENT	X		REPLACE ELEMENT